

HARVEY DONALDSON & GIBSON

CHARTERED SURVEYORS

Parent to HomeReportScotland.scot







- 1. Single Survey
- 2. Energy Report
- 3. Property Questionnaire



survey report on:

52 Strathblane Gardens, Glasgow, G13 1BX
--

Customer	Mr D Roberston
----------	----------------

Customer address	Flat 0/1, 52 Strathblane Gardens, Glasgow, G13 1BX

Prepared by	Harvey Donaldson And Gibson
-------------	-----------------------------

Date of inspection	20th June 2023
--------------------	----------------



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The ultimate holding company of Harvey Donaldson & Gibson is Countrywide plc. In Scotland, Countrywide plc also own Slater Hogg & Howison and Countrywide North. A full list of estate agents owned or under franchise to Countrywide plc is available on request. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
 or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information

contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property:
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be

researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a purpose built, ground floor flat in a four storey, mid range block containing eight flats in all.
Accommodation	Ground floor: Entrance hall, open plan lounge/kitchen, 2 bedrooms, en-suite shower room and master bathroom.
Gross internal floor area (m²)	64.
Neighbourhood and location	The property is located in a popular and established residential location developed in a variety of property types within the Anniesland district, lying to the west of the City. There are normal amenities within a reasonably short distance.
Age	21 years.
Weather	Dry.
Chimney stacks	None.
Roofing including roof space	The roof is hipped and pitched, timber supported and clad externally in concrete interlocking tiles, topped in concrete ridging and incorporating a mono-pitched section to the front, believed to be clad in lead with copper cladding. This cannot be inspected from ground level. The roof space has not been inspected as there are no common hatches, access via the top floor flats only.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate. Rainwater discharge is via uPVC gutters and downpipes.

Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls of the property are of modern timber framed construction, measuring approximately 280mm in thickness, finished externally in render, facing brick and metal cladding, all plasterboard dry lined internally.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	Timber framed double glazed windows and external lounge doors. Timber entrance door. Timber gutter boards/ soffits at the eaves of the roof.
Fotom of the continue	
External decorations	Visually inspected.
	The external joinery is painted.
Conservatories / porches	None.
Communal areas	Circulation areas visually inspected.
	Access to the block is via a voice controlled security door entry system, leading to concrete floors, stairs and landings. Ceilings are plasterboard. Communal lighting is provided.
Garages and permanent outbuildings	None.
Outside areas and boundaries	Visually inspected.
	The building is set within communal garden grounds, and off street resident's car parking is provided.
	There is a small paved area immediately to the front of the property accessed off the lounge/ kitchen which the Vendor has advised pertains the subject flat.
Ceilings	Visually inspected from floor level.
	The ceilings are plasterboard.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	The internal walls are of timber studwork framed construction, lined with plasterboard.
Flat 0/1 52 Strathhlane Gardens	

Flat 0/1, 52 Strathblane Gardens, Glasgow, G13 1BX 20th June 2023 QV111222

Floore includios sub-floore	
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	Flooring throughout the property is assumed solid construction with floating timber/ chipboard finish, all of which have fully fitted floor coverings.
	No sub floor available for inspection.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	Internal joinery comprises timber skirtings, door facings and door surrounds, and flush fit internal pass doors.
	Kitchen fittings comprise a range of wall and base units, and work surfaces.
Chimney breasts and fireplaces	None.
Internal decorations	Visually inspected.
	Painted walls and ceilings, glossed/ varnished internal woodwork, etc.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. A mains supply of electricity is connected to the property, the electrical meter and circuit breaker consumer unit located in a hall
	cupboard, and serving 13 Amp square pin sockets throughout. Wiring, where visible, is sheathed in uPVC.

Gas

Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.

A mains supply of gas is connected, the gas meter located externally in a uPVC housing.

Water, plumbing, bathroom fittings

Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.

No tests whatsoever were carried out to the system or appliances.

Cold water is from the mains supply. Visible plumbing comprises copper and uPVC supply pipework.

The en-suite shower room contains a wash hand basin, WC and shower cubicle with electric shower. The bathroom contains a bath with shower over, wash hand basin and WC.

Heating and hot water

Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.

No tests whatsoever were carried out to the system or appliances.

The property is centrally heated by means of a gas fired system, comprising a condensing combination boiler in a hall cupboard. Heating to the rooms is provided by water filled radiators. The system is of a type designed to provide instantaneous hot water upon demand.

Drainage

Drainage covers etc were not lifted.

Neither drains nor drainage systems were tested.

The property is believed to be connected to mains drainage.

Fire, smoke and burglar alarms

Visually inspected.

No tests whatsoever were carried out to the system or appliances.

The property has linked smoke/ heat detectors and carbon monoxide alarms.

Scottish government regulations came into effect on February 2022 which require each property to have linked smoke and heat detectors and if gas/carbon burning appliances are present then a carbon monoxide alarm fitted. Purchasers should satisfy themselves with regards to compliance.

Any additional limits to inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

The property was inspected within the limits imposed by occupation which included, throughout, closely nailed and fixed fitted carpeting, floor coverings, stored items, furnishings etc. The owner's personal belongings were not removed from cupboards.

It will be appreciated that parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.


This report does not constitute a full and detailed description of the property and a structural investigation was not carried out. No inspection was undertaken of woodwork or other parts of the structure which are covered, unexposed or otherwise inaccessible and as a result no guarantee can be given that such parts of the structure are free from rot, beetle or other defects.

No removal of internal linings has been carried out in order to ascertain the condition of hidden parts and no warranty can be given regarding the areas not specifically referred to in this report.

The external building fabric has been inspected from ground level only from the subjects grounds and where possible from adjoining public property. Exposure work has not been carried out.

It was dry on the date of inspection. Leakage and water penetration within roof spaces, around chimney breasts, window openings, etc are sometimes only visible during or immediately after, adverse weather conditions.

Sectional Diagram showing elements of a typical house

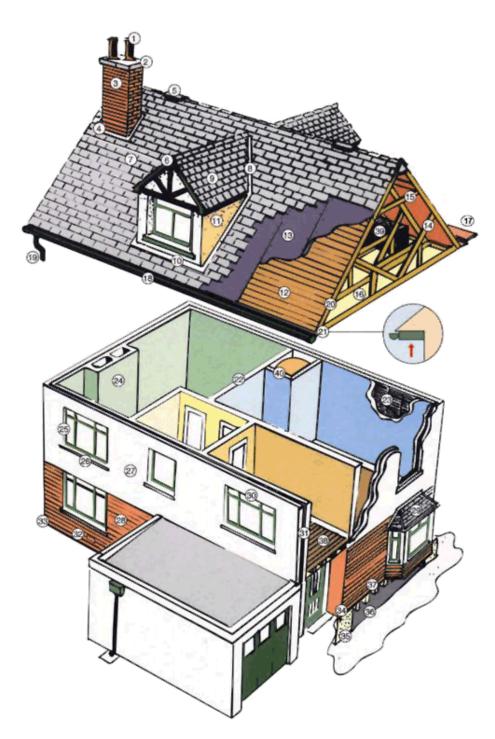

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10) Dormer flashing
- 11) Dormer cheeks
- 12) Sarking
- (13) Roof felt
- (14) Trusses
- (15) Collar
- 16 Insulation
- 17) Parapet gutter
- 18) Eaves guttering
- 19) Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- 25) Window pointing
- 6) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- 30 Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33 Damp proof course
- 34) Base course
- 35) Foundations
- (36) Solum
- 37) Floor joists
- 38) Floorboards
- 39) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement		
Repair category	1	
Notes	No visible evidence of significant structural movement was noted within the limitations of the inspection.	

Dampness, rot and infestation	
Repair category	1
Notes	An electronic moisture meter was used to measure levels of dampness, at random locations, to lower wall surfaces and floors, where accessible and without moving furniture or lifting floor coverings, if present.
	No obvious significant dampness, timber decay or infestation noted, within the limitations imposed on the inspection.

Chimney stacks	
Repair category	-
Notes	N/A.

Roofing including roof space	
Repair category	1
Notes	Roof tiling, where viewed from ground level, appears to have been laid to generally even courses with no obvious significant defects noted.

Rainwater fittings	
Repair category	1
Notes	No significant disrepair was noted to rainwater goods. It will however be appreciated that the inspection was carried out during dry weather conditions. Sometimes defects in rainwater goods are only apparent during, or after heavy rainfall.

Main walls	
Repair category	1
Notes	No obvious significant defects were noted to accessible wall surfaces. As the building within which the subject property is located does not, based on our visual inspection, give rise to any specific cause for concern and/or the RICS External Wall System Review Process is not considered to be applicable, based on current RICS guidance, we have assumed that it is free from any/all fire safety defects and is fully compliant with and meets all current building regulation and fire safety standards. However, this decision is not a guarantee that works will not be required in future.

Windows, external doors and joinery	
Repair category	1
Notes	No obvious significant defects were noted to the windows, doors or external joinery.

External decorations	
Repair category	1
Notes	No obvious significant defects noted.

Conservatories/porches	
Repair category	-
Notes	N/A.

Communal areas	
Repair category	1
Notes	No obvious significant defects were noted to communal areas.

Garages and permanent outbuildings	
Repair category	-
Notes	N/A.

Outside areas and boundaries	
Repair category	1
Notes	Outside areas and boundaries appear adequate for purpose. The property is situated close to mature trees. Whilst no obvious physical damage was evident, it should be noted that is not recommended that trees be planted closer to a building than a distance equal to their fully grown height. Tree roots can cause damage to structures and services, particularly in shrinkable soils. The requirement for gutter maintenance in the autumn should also be recognised, along with the risk of storm damage.

Ceilings	
Repair category	1
Notes	No obvious significant defects were noted to ceiling surfaces.

Internal walls	
Repair category	1
Notes	No obvious significant defects were noted to internal walls and partitions, within the limitations imposed on the inspection.

Floors including sub-floors	
Repair category	1
Notes	No obvious significant defects were noted to flooring, within the limitations imposed by fully fitted floor coverings.

Internal joinery and kitchen fittings	
Repair category	1
No obvious significant defects were noted to internal joinery or kitchen fittings.	

Chimney breasts and fireplaces	
Repair category	-
Notes	N/A.

Internal decorations	
Repair category	1
Notes No obvious significant defects were noted to the internal decoration.	

Cellars	
Repair category	-
Notes	N/A.

Electricity	
Repair category	1
Notes	The electrical installation appeared to be in a condition commensurate with age and type with no visual defects being apparent. However, it should be fully appreciated that only the most recently re-wired or constructed properties will comply with current regulations. It is recommended good practice that all electrical installations should be checked periodically, approximately every ten years or when a property changes hands.
	This should be regarded as a routine safety and maintenance check.

Ø Gas	
Repair category	1
Notes	No obvious significant defects noted. All gas appliances should be tested and thereafter regularly maintained by a Gas Safe registered contractor.

Water, plumbing and bathroom fittings		
Repair category	1	
Notes	No obvious significant defects noted to accessible plumbing or sanitary fittings.	

Heating and hot water	
Repair category	1
Notes	No obvious significant defects were noted to the heating system or hot water system, although these have not been tested. It is recommended good practice that gas boilers are serviced on an annual basis by an appropriately qualified person. The boiler's service history should be checked by referring to the service records. If there is no record of a recent service, the boiler should be checked by an appropriately qualified person.

Drainage	
Repair category	1
Notes	No obvious significant defects were noted to the drainage system, within the limitations of the inspection.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	1
Garages and permanent outbuildings	-
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground Floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes X No
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

As the building within which the subject property is located does not, based on our visual inspection, give rise to any specific cause for concern and/or the RICS External Wall System Review Process is not considered to be applicable, based on current RICS guidance, we have assumed that it is free from any/all fire safety defects and is fully compliant with and meets all current building regulation and fire safety standards. However, this decision is not a guarantee that works will not be required in future.

It is an essential condition of the valuation reported that confirmation be sought from your chosen Lender of their acceptance of the current RICS guidance – 'Valuation of properties in multi-storey, multi-occupancy residential buildings with cladding', issued 8th March 2021. As guidance from RICS and MHCLG is continuously evolving, we will report as per the current edition

The tenure is understood to be Outright Ownership.

It would be prudent to check with the managing agents and/or co-proprietors as to any contemplated or proposed communal repairs.

Normal local practice is for common repairs to be shared on an equitable basis. This has been assumed to be the position in this case.

The property is situated in an area of past mining activity. The conveyancer should obtain a mining report from The Coal Authority to provide information as to historical and future mining activity and whether the property has been the subject of any compensation claims, ensuring that the property is not adversely affected. The valuation assumes the content will reveal nothing adverse.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

Estimated reinstatement cost for insurance purposes

£195,000 (One Hundred and Ninety Five Thousand Pounds).

The re-building cost for insurance purposes is for the subject property only and is given solely as a guide, as it is assumed the building as a whole is insured under a single policy.

Valuation and market comments

MARKET VALUATION

In its present condition the opinion of valuation for the Outright Ownership interest of the property with vacant possession on 20th June 2023 is £150,000 (One Hundred and Fifty Thousand Pounds Sterling).

Security Print Code [579187 = 7977] Electronically signed
, ,

Report author	Brett G McMillan
Company name	Harvey Donaldson And Gibson
Address	Suite 3/7 Standard Buildings, 94 Hope Street, Glasgow, G2 6PH
Date of report	21st June 2023



Property Address				
Address Seller's Name Date of Inspection	Flat 0/1, 52 Stratt Mr D Roberston 20th June 2023	nblane Gardens,	Glasgow, G13 1BX	
Property Details				
Property Type	House X Purpose built flat	Bungalow Converted flat	Purpose built maiso Tenement flat	nette Converted maisonette Flat over non-residential use Other (specify in General Remarks)
Property Style	Detached Back to back	Semi detached High rise block	Mid terrace X Low rise block	End terraceOther (specify in General Remarks)
Does the surveyor be e.g. local authority, m		erty was built for	the public sector,	Yes X No
Flats/Maisonettes onl	y Floor(s) on which	located Ground	No. of floors in block	
Approximate Year of	Construction 2002		140. Of drine in block	0
Tenure				
X Absolute Ownership	Leasehold	Ground rent £	Unexpire	d years
Accommodation				
Number of Rooms	1 Living room(s)2 Bathroom(s)	2 Bedroom(s) 0 WC(s)	1 Kitchen(s) 0 Other (Specify in 6	General remarks)
Gross Floor Area (exc	cluding garages ar	d outbuildings)	64 m² (Internal)	73 m² (External)
Residential Element (greater than 40%)	X Yes No		
Garage / Parking /	Outbuildings			
Single garage Available on site?	Double garage X Yes No	X Parki	ng space	No garage / garage space / parking space
Permanent outbuildin	gs:			
None.				

Construction							
Walls	Brick	Stone	Concrete	X Timber frame	Other	(specify in Gen	eral Remarks)
Roof	X Tile	Slate	Asphalt	Felt	_	(specify in Gen	
Special Risks							
Has the property su	ffered structu	ıral movement'	?			Yes	X No
If Yes, is this recent	or progressi	ve?				Yes	No
Is there evidence, h immediate vicinity?	istory, or rea	son to anticipa	te subsidence,	heave, landslip o	r flood in the	Yes	X No
If Yes to any of the	above, provid	de details in Ge	eneral Remarks	5.			
Service Connection	on						
Based on visual inspof the supply in Gen			appear to be	non-mains, please	e comment or	n the type ar	nd location
Drainage [X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	X Mains	Private	None
Central Heating [X Yes [Partial	None				
Brief description of 0	Central Heati	ng:					
Gas fired boiler to	radiators.						
Site							
Apparent legal issue	es to be verifi	ed by the conv	evancer Pleas	se provide a brief	description in	General R	amarks
Rights of way	Shared drive			amenities on separate		ed service conn	
Ill-defined boundaries			I land included wit	·			neral Remarks)
Location							
Residential suburb	X Resid	dential within town	/ city Mixed	d residential / commerc	cial Mainl	y commercial	
Commuter village	Rem	ote village	Isolat	ed rural property	Other	(specify in Ge	neral Remarks)
Planning Issues							
Has the property be	en extended	/ converted / a	ltered?	es X No			
If Yes provide detail	s in General	Remarks.					
Roads							
X Made up road	Unmade road	Partly cor	npleted new road	Pedestrian ad	ccess only	Adopted	Unadopted

en			-	\sim	_			—
-	1	ale I	-4			-	14	'4 ~

The subjects comprise a purpose built, ground floor flat in a four storey, mid range block containing eight flats in all.

The property is located in a popular and established residential location developed in a variety of property types within the Anniesland district, lying to the west of the City. There are normal amenities within a reasonably short distance.

When inspected within limits imposed by occupation, the general condition of the property appears consistent with its age and type of construction, and no obvious significant defects were noted which would adversely affect the subjects as a mortgage security.

As the building within which the subject property is located does not, based on our visual inspection, give rise to any specific cause for concern and/or the RICS External Wall System Review Process is not considered to be applicable, based on current RICS guidance, we have assumed that it is free from any/all fire safety defects and is fully compliant with and meets all current building regulation and fire safety standards. However, this decision is not a guarantee that works will not be required in future.

Essential Repairs				
None noted.				
Estimated cost of essential repairs £	Retention recommended? Yes	X No	Amount £	

Commen	t on Mor	taaaea	bilitv

The property affords adequate security for loan purposes based on the valuation figure, subject to individual lender's criteria.

It is an essential condition of the valuation reported that confirmation be sought from your chosen Lender of their acceptance of the current RICS guidance – 'Valuation of properties in multi-storey, multi-occupancy residential buildings with cladding', issued 8th March 2021. As guidance from RICS and MHCLG is continuously evolving, we will report as per the current edition.

lua		

Market value in present condition

£ 150,000

Market value on completion of essential repairs

2

Insurance reinstatement value

£ 195,000

(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary?

Yes X No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis?

Is the property in an area where there is a steady demand for rented accommodation of this type?

Yes	No

Declaration

Signed Security Print Code [579187 = 7977]

Electronically signed by:-

Surveyor's name Brett G McMillan

Professional qualifications MRICS

Company name Harvey Donaldson And Gibson

Address Suite 3/7 Standard Buildings, 94 Hope Street, Glasgow, G2 6PH

 Telephone
 0141 204 0808

 Fax
 0203 880 9193

 Report date
 21st June 2023

Energy Performance Certificate (EPC)

Dwellings

Scotland

FLAT 0/1, 52 STRATHBLANE GARDENS, GLASGOW, G13 1BX

Dwelling type: Ground-floor flat Date of assessment: 20 June 2023 Date of certificate: 21 June 2023 **Total floor area:** 64 m²

Primary Energy Indicator: 178 kWh/m²/year Reference number: Type of assessment: **Approved Organisation:** Main heating and fuel:

1417-0726-3000-0740-5222 RdSAP, existing dwelling

Elmhurst


Boiler and radiators, mains

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£3,216	See your recommendations
Over 3 years you could save*	£192	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

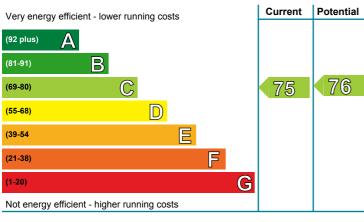


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is band C (75). The average rating for EPCs in Scotland is band D (61).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

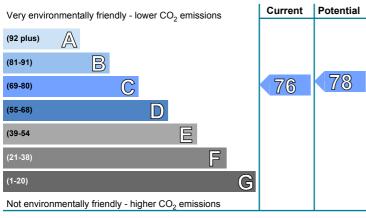

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is band C (76). The average rating for EPCs in Scotland is band D (59).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (suspended floor)	£800 - £1,200	£192.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282

THIS PAGE IS THE ENERGY PERFORMANCE **CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS** REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, insulated (assumed)	★★★★ ☆	★★★★ ☆
Roof	(another dwelling above)	_	_
Floor	Suspended, insulated (assumed)	_	_
Windows	Fully double glazed	★★★☆☆	★★★☆☆
Main heating	Boiler and radiators, mains gas	★★★★ ☆	★★★★ ☆
Main heating controls	Programmer, TRVs and bypass	★★★☆☆	★★★☆☆
Secondary heating	None	_	_
Hot water	From main system	★★★★ ☆	★★★★ ☆
Lighting	Low energy lighting in all fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 31 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.0 tonnes of carbon dioxide every year. You could reduce emissions by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,163 over 3 years	£1,968 over 3 years	
Hot water	£702 over 3 years	£705 over 3 years	You could
Lighting	£351 over 3 years	£351 over 3 years	save £192
Totals	£3,216	£3,024	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

December ded massives	In direction and	Typical saving	Rating after improvement		
Recommended measures	Indicative cost	per year	Energy	Environment	
1 Floor insulation (suspended floor)	£800 - £1,200	£64	C 76	C 78	

Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	4,402	N/A	N/A	N/A
Water heating (kWh per year)	1,916			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Brett McMillan Assessor membership number: EES/016274

Company name/trading name: Harvey Donaldson & Gibson Chartered Surveyors Address: Suite 3/7 Standard Buildings 94 Hope Street

Suite 3/7 Standard Buildings 94 Hope Street Glasgow

Glasgow G2 6PH

Phone number: 0141 2040808

Email address: frances.wilson@hdg.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Property Address	0/1, 52 Strathblane Gardens, Glasgow, East Renfrewshire, G13 1BX
Vendor(s)	Mr David Robertson
Completion Date of Property Questionnaire	
System Ref:	QV111222





Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership					
	How long have you owned the property? 2 years, 8 months					
2.	Council Tax					
	Which Council Tax band is your property in?					
	A 😵 B 😵 C 🔮 D 😵 E 😵 F 😵 G	\otimes	Н	×		
3.	Parking					
	What are the arrangements for parking at your property? Please tick all that apply?					
	Garage ⊗ Allocated parking space ✓ Driveway €					
	Shared parking ♥ On street ♦ F	Resident pe	ermit	×		
	Metered parking 🔕 Other (please specify):					
4.	Conservation area					
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?		Yes No			
	,	Don't k	cnow	×		
5.	Listed buildings					
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?		Yes No			
6.	Alterations/additions/extensions					
	During your time in the property, have you carried out any structural alterations, additions or		Yes	×		
a.	extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?		No			
(i)	If you have answered yes, please describe below the changes which you have made:					
411	Did you obtain planning permission, building warrant, completion certificate and other		Yes	×		
(ii)	consents for this work?		No	×		
(iv)	If you have answered yes, the relevant documents will be needed by the purchaser and you she solicitor as soon as possible for checking. If you do not have the documents yourself, please not these documents and your solicitor or estate agent will arrange to obtain them:			our		



6.	Alterations/additions/extensions	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below	Yes 😵
		No 🕢
(i)	Were the replacements the same shape and type as the ones you replaced?	Yes 😵
(-)	replaced:	No 😵
/::\	Did the work involve any changes to the window or door openings?	Yes 😵
(ii)		No 🐼
	Please describe the changes made to the windows doors, or patio doors (with approximate date	es when the work was
	completed):	
(iii)	Please give any guarantees which you received for this work to your solicitor or estate agent	
(,		
-	Control hosting	
7.	Central heating	
	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main	Yes 🗸
a.	rooms of the property —	No 😵
	the main living room, the bedroom(s), the hall and the bathroom).	Partial 🚫
	If you have answered yes or partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air)	
	Gas fired combi boiler	
	If you have answered yes, please answer the three questions below	
(i)	When was your central heating system or partial central heating installed?	New boiler 4-5
		years ago
	Do you have a maintenance contract for the central heating system?	Yes 😵
(ii)		No 🕢
(")	If you answered yes please give details of the company with whom you have a maintenance co	ontract
	When was your maintenance contract last renewed? (Please provide the month and year)	
(iii)		
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less	Yes 😵
	than 10 years old?	No 🗸
9.	Issues that may have affected your property	140
9.		
a.	Has there been any storm, flood, fire, or other structural damage to your property while you have owned it?	Yes 🔕
		No 🕢
	<u>If you have answered yes</u> is the damage the subject of any outstanding insurance claim?	Yes 😵
	insurance claim?	No 😵
	Are you aware of the existence of asbestos in your property?	Yes 😵
b.		No 🕢
	If you have answered yes please give details:	



10.	Services				
	Please tick which services are connected	ed to your propert	y and give details of	the supplier	
	Service	Connected	Suppl	ier	
	Gas or liquid petroleum gas		Ovo Ene	ergy	
	Water mains or private water supply		Scottish V	Vater	
a.	Electricity		Ovo Ene	ergy	
	Mains drainage		Scottish V	Vater	
	Telephone		Vodafo	ne	
	Cable TV or satellite		Sky satellite and o	cable installed	
	Broadband		Vodafo	ne	
L	Is there a septic tank at your property?			Yes 😵	
b.	If you have answered yes please answered	wer the questions	below	No 🤡	
	Do you have appropriate consents for the	he discharge of y	our septic tank?	Yes 😵	
(i)			No 😵		
				Don't know 🚫	
	Do you have a maintenance contract fo	Yes 😵			
/::\	No.				
(ii)	<u>If you answered yes</u> please give details of the company with whom you have a maintenance contract				
11.	Responsibilities for shared or comm	on areas			
	Are you aware of any responsibility to contribute to the cost of anything				
				Yes 🗸	
	used jointly, such as repair of a shared garden area?			Yes ♥ No ⊗	
a.	used jointly, such as repair of a shared				
a.	used jointly, such as repair of a shared			No 😵	
a.	used jointly, such as repair of a shared garden area?	drive, private roa		No 🔕	
a.	used jointly, such as repair of a shared garden area? If you answered yes please give details Monthly factor fee - £76/month. Newton Are you aware of any responsibility to c	drive, private roa Property contribute to the c	d, boundary, or	No 🔕	
a.	used jointly, such as repair of a shared garden area? If you answered yes please give details Monthly factor fee - £76/month. Newton	drive, private roa Property contribute to the c	d, boundary, or	No ⊗ Don't know ⊗	
a. b.	used jointly, such as repair of a shared garden area? If you answered yes please give details Monthly factor fee - £76/month. Newton Are you aware of any responsibility to c	drive, private roa Property contribute to the c	d, boundary, or	No ⊗ Don't know ⊗ Yes ✓	
	used jointly, such as repair of a shared garden area? If you answered yes please give details Monthly factor fee - £76/month. Newton Are you aware of any responsibility to c	drive, private roa Property contribute to the c	d, boundary, or	No & Don't know Yes No &	
	used jointly, such as repair of a shared garden area? If you answered yes please give details Monthly factor fee - £76/month. Newton Are you aware of any responsibility to c maintenance of the roof, common stairs	drive, private roa Property contribute to the c	d, boundary, or	No ⊗ Don't know ⊗ Yes ♥ No ⊗	
b.	used jointly, such as repair of a shared garden area? If you answered yes please give details Monthly factor fee - £76/month. Newton Are you aware of any responsibility to c maintenance of the roof, common stairs If you answered yes please give details Yes Has there been any major repair or repl	Property contribute to the covell, or other com	ost of repair and mon areas?	No ⊗ Don't know ⊗ Yes ♥ No ⊗	
	used jointly, such as repair of a shared garden area? If you answered yes please give details Monthly factor fee - £76/month. Newton Are you aware of any responsibility to c maintenance of the roof, common stairs If you answered yes please give details Yes	Property contribute to the covell, or other com	ost of repair and mon areas?	No & Don't know Yes No & Don't know &	
b.	used jointly, such as repair of a shared garden area? If you answered yes please give details Monthly factor fee - £76/month. Newton Are you aware of any responsibility to comaintenance of the roof, common stairs If you answered yes please give details Yes Has there been any major repair or repl during the time you have owned the buil	Property contribute to the convell, or other completed any partial inding?	ost of repair and mon areas?	No & Don't know & Service Yes Voon't know & Service Yes Voon't know & Service Yes & Service Yes Ser	
b. c.	used jointly, such as repair of a shared garden area? If you answered yes please give details Monthly factor fee - £76/month. Newton Are you aware of any responsibility to comaintenance of the roof, common stairs If you answered yes please give details Yes Has there been any major repair or repl during the time you have owned the buil	Property contribute to the convell, or other completed any partial inding?	ost of repair and mon areas?	No & Don't know & Service Serv	
b.	used jointly, such as repair of a shared garden area? If you answered yes please give details Monthly factor fee - £76/month. Newton Are you aware of any responsibility to comaintenance of the roof, common stairs If you answered yes please give details Yes Has there been any major repair or repl during the time you have owned the buil	Property contribute to the convell, or other completed any partial inding?	ost of repair and mon areas?	No & Don't know & Son't know &	



11.	Responsibilities for shared or common areas	
	As far as you are aware, do any of your neighbours have the right to walk over your	Yes 😵
	property, for example to put out their rubbish bin, or to maintain their boundaries?	No 🕢
e.	If you answered yes please give details	
	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.)	Yes 🔕
f.		No 🗸
''	<u>If you answered yes</u> please give details	
12.	Charges associated with your property	
	Is there a factor or property manager for your property?	Yes 🗸
a.		No 😵
	If you answered yes please provide name and address and give details relating to deposits held	d and charges
	Newton Property - £76/month	
	Is there a common buildings insurance policy?	Yes 🗸
		No 😵
b.		Don't know 🚫
	<u>If you answered yes</u> is the cost of insurance included in your monthly/annual factor's charges? Yes	Yes
		No
	Please give details of any other charges you have to pay on a regular basis for the up areas or repair works, for example to a residents' association, or maintenance or stair	
C.	NA	
40	Chanialist would	
13.	Specialist works	
	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes 🔕
		No 🤣
	If you answered yes please give further details	
a.	Do you have any suggestion for this world?	
	Do you have any guarantees for this work?	Yes 😵
	Cuaranto as are hold by:	No 😵
	Guarantees are held by : As far as you are aware, has any preventative work for dry rot, wet rot, or damp	
	ever been carried out to your property?	Yes 😵 No 🕢
	<u>If you answered yes</u> please give further details	NO V
b.	II you answered yes please give further details	
J.	Do you have any guarantees for this work?	Yes 🔕
	Do you have any guarantous for the work:	No 🐼
	Guarantees are held by :	140



14.	Guarantees					
	Are there any warranties or guarantees for any of the following					
a.		No	Yes	Don't know	With title deeds	Lost
(i) b.	Electrical work	8	8	Ø	8	8
(ii) b.	Roofing	8	8	Ø	8	8
(iii) b.	Central heating	8	8	Ø	8	8
(iv) b.	National House Building Council (NHBC)	8	8	Ø	8	8
(v) b.	Damp course	8	8	Ø	8	8
(vi)	Any other work or installation? (for example cavity wall insulation, underpinning, indemnity policy)	×	×		×	×
b.		<u>I</u>				
	Are there any outstanding claims under any of the guarantees listed ab	ove?				es 😵 No 😵
c.	<u>If you answered yes</u> please give details					
15.	Boundaries					
	Are you aware has any boundary of your property been moved ten years?	in the I	ast			es 😵 No 🧭
a.				Do	n't kno	w 😵
	<u>If you answered yes</u> please give details					



16.	Notices that affect your property	
	In the past three years have you ever receievd a notice :	
a.	Advising that the owner of a neighbouring property has made a planning application?	Yes ⊗ No ⊘
b.	that affects your property in some other way?	Yes No 🥥
c.	that requires you to perform any maintenance, repairs, or improvements to the property?	Yes ⊗ No ⊘
	If you answered yes to any of a-c above please give the notices to your so agent, including any notices which arrive at any time before the date of entry of your property	olicitor or estate of the purchaser

Declaration by the seller(s) or other authorised body or person(s)

I/We confirm that the information on this form is true and correct to the best of my/our knowledge and belief.

Signatures:

David Robertson

Date:





3/7 Standard Buildings, 94 Hope Street, Glasgow, G2 6PH 0141 2040808 glasgow.residential@hdg.co.uk