

HARVEY DONALDSON & GIBSON

CHARTERED SURVEYORS

Parent to HomeReportScotland.scot







- 1. Single Survey
- 2. Energy Report
- 3. Property Questionnaire



survey report on:

Property address	7 Parkhill Crescent, Aberdeen, AB21 7FY
Customer	Mr M Grant, Miss S Harper
Customer address	
Prepared by	Harvey Donaldson And Gibson
Date of inspection	19th September 2023



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

Х

The ultimate holding company of Harvey Donaldson & Gibson is Countrywide plc. In Scotland, Countrywide plc also own Slater Hogg & Howison and Countrywide North. A full list of estate agents owned or under franchise to Countrywide plc is available on request. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
 or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information

contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be

researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	A detached two storey dwelling house.		
Accommodation	The accommodation comprises:		
	Ground floor-Entrance vestibule, hallway with cloakroom off having w.c. dining kitchen, living room, family room, utility room.		
	First floor-Landing, three bedrooms, bathroom with w.c.		
Gross internal floor area (m²)	113		
Neighbourhood and location	The subjects form part of an established residential area in the Dyce suburb of Aberdeen , lying some 6 miles north west of the city centre. Surrounding properties are of similar age and character. A wide range of facilities and amenities can be found within a reasonable distance.		
Age	53 years.		
Weather	Dry and dull.		
Chimney stacks	None.		
Roofing including roof space	The main roof is pitched and covered with concrete interlocking tiles with a tiled ridge and PVC verge caps.		
	Access to the roof space is via a hatch and retractable ladder on the landing ceiling,		
	The roof is made up of timber rafters with timber sarking boards.		
	The roof sections over the extensions are mono pitched and covered with concrete interlocking tiles. with cement verges.		
	There is no access to the roof spaces of both extensions.		

Rainwater fittings	The rainwater fittings are of a PVC type.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls are of traditional cavity brick construction, finished externally in roughcast, with pointed synthetic stone features.
	The walls of the extensions appear of solid blockwork construction, rendered externally with pointed synthetic stone features.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	The windows are of a double glazed uPVC type. The front door is a timber and glazed unit. The rear door is a uPVC unit with a double glazed panel. There are double glazed uPVC patio doors off the rear sitting room.
	The fascia boards and soffits at the eaves of the roof are uPVC
External decorations	Self coloured uPVC materials. External surfaces are painted, where applicable.
Conservatories / porches	None.
Communal areas	None.
Garages and permanent outbuildings	Single car detached garage of rendered blockwork construction under a flat felt covered roof.
	Vehicular access is by way of an electrically operated up and over metal door. There is a timber pedestrian door and timber window.
	There is a timber shed in the rear garden. No inspection carried out.
Outside areas and boundaries	There are garden grounds to the front, side and rear, with driveway parking, adequately bounded by blockwork walls and timber fencing.
	Garden areas are mainly laid to grass. The driveway is surfaced with tarmacadam.
	Paths are formed in concrete slabs together with a patio area.

0 ""	
Ceilings	Visually inspected from floor level.
	The ceilings are plasterboard lined.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Internal walls are partly plastered on the hard and partly lined in plasterboard.
Floors including sub floors	Flooring throughout the property is of suspended timber design, overlaid in tongue and groove boarding, all of which have fully fitted floor coverings. Flooring in the rear extension appears of concrete design, overlaid in a timber floating floor.
	No access to sub floor.
Internal joinery and kitchen fittings	Timber skirtings, door facings and door surrounds and timber internal pass doors, some of which have glazed panels. The staircase is timber.
	Kitchen fittings comprise a range of wall and base units and work surfaces.
Chimney breasts and fireplaces	There is a living flame gas fire in the living room set on a marble hearth.
Internal decorations	Visually inspected.
	The ceilings and walls are painted.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Electricity is supplied from the mains. The meter is located in an external meter box. located at the front of the property. The consumer unit is located in the cupboard under the stairs.
	The system appears to be of a 13 amp type and design. The switch and socket outlets are plastic and the wiring is sheathed with PVC, where visible.
Gas	Gas is supplied from the mains. The meter is located in the cupboard under the stairs.

Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Water is supplied from the mains.
	The bathroom contains a bath, wash hand basin, separate shower cubicle and w.c. The cloakroom contains a wsh hand basin and w.c.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	The property is heated by a gas fired condensing boiler. The boiler is a combination boiler also providing hot water direct to taps.
	Heating to the rooms is provided by water filled radiators.
Drainage	Drainage covers etc were not lifted.
	Neither drains nor drainage systems were tested.
	Mains drainage is understood to be connected.
Fire, smoke and burglar alarms	The property has smoke detectors.
	Scottish government regulations came into effect on 1st February 2022 which requires each property to have linked smoke and heat detectors and if gas/carbon burning appliances are present then a carbon monoxide alarm fitted. Purchasers should satisfy themselves with regards to compliance.

Any additional limits to inspection

The property had fitted floor coverings throughout.

No access was gained to the sub floor.

A limited inspection was possible of the roof void due to insulation material, partial flooring and stored belongings.

No close inspection was possible to enclosed areas beneath and around washing appliances and sanitary fittings.


Not all windows were tested as some were locked. Storage cupboards full of personal belongings were not disturbed. An external inspection was carried out from ground level within the boundaries of the property and from adjoining highways.

Areas of the property that were covered, unexposed or inaccessible have not been inspected. It cannot be confirmed that such areas are free from infestation, decay or other defects.

The report does not include an asbestos inspection. However, asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.

It should be appreciated that further defects can arise after the date of our inspection.

Sectional Diagram showing elements of a typical house

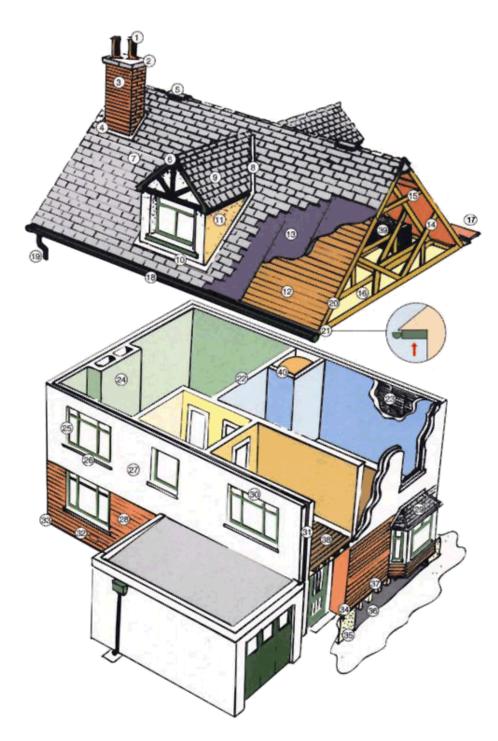

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4 Flashing
- (5) Ridge ventilation
- 6 Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- 9) Dormer projection
- 10) Dormer flashing
- (11) Dormer cheeks
- 12) Sarking
- (13) Roof felt
- (14) Trusses
- (15) Collar
- 16) Insulation
- 17) Parapet gutter
- (18) Eaves guttering
- 19) Rainwater downpipe
- 20) Verge boards /skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- (25) Window pointing
 - 6) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- 30 Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- (33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- 39) Water tank
- 40 Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	No obvious significant structural movement noted, on the basis of a single inspection.

Dampness, rot and infestation	
Repair category	1
Notes	An electronic moisture meter was used to measure levels of dampness, at random locations, to lower wall surfaces and floors, where accessible and without moving furniture or lifting floor coverings, if present. No obvious significant dampness, timber decay or infestation noted, within the limitations imposed on the inspection.

Chimney stacks	
Repair category	-
Notes	Not applicable.

Roofing including roof space	
Repair category	2
Notes	Moss growth was noted.
	Hairline cracking noted to cement verges.
	The manufacturers of concrete roof tiles expect that a roof tile will normally last for approximately 50 years. This should be taken into consideration having regard to the age of the property.

Rainwater fittings	
Repair category	1
Notes	No significant disrepair was noted to rainwater goods. It will however be appreciated that the inspection was carried out during dry weather conditions. Sometimes defects in rainwater goods are only apparent during, or after heavy rainfall.

Main walls	
Repair category	1
Notes	No obvious significant defects were noted to accessible wall surfaces.

Windows, external doors and joinery	
Repair category	1
Notes	No obvious significant defects were noted to windows, doors or external joinery.

External decorations	
Repair category	1
Notes	No obvious significant defects noted.

Conservatories/porches	
Repair category	-
Notes	Not applicable.

Communal areas	
Repair category	-
Notes	Not applicable.

Garages and permanent outbuildings	
Repair category	2
Notes	Water was noted to be lying on the garage roof. Staining was noted to the roof timbers.
	Flat roofs have a limited life and generally require higher than average levels of maintenance.
	Weathered paintwork noted to timber door and window.

Outside areas and boundaries	
Repair category	1
Notes	Cracking was noted to boundary walling.

Ceilings	
Repair category	1
Notes	No obvious significant defects were noted to ceiling surfaces.

Internal walls	
Repair category	1
Notes	No obvious significant defects were noted to internal walls and partitions, within the limitations imposed on the inspection.

Floors including sub-floors	
Repair category	1
Notes	No obvious significant defects were noted to flooring, within the limitations imposed by fully fitted floor coverings.
	No access to the sub floor was possible due to fitted and fixed floor coverings throughout at the time of our visit. Within the limitations of our surface inspection there was no indication to suggest significant defects in this area. It will however be appreciated that this area was not inspected and therefore no guarantees can be provided in this regard.
	Spillage often occurs to enclosed areas around sanitary fittings and washing appliances with consequent risk of deterioration or decay. The need for repairs can be revealed when coverings and fittings are removed.

Internal joinery and kitchen fittings	
Repair category	1
Notes	The internal joinery and kitchen units appear satisfactory allowing for age and wear.
	There are timber panel doors incorporating glazing panels and the presence of safety glass cannot be verified.

Chimney breasts and fireplaces	
Repair category	1
Notes	All gas appliances should be tested and thereafter regularly maintained by a Gas Safe registered contractor.

Internal decorations	
Repair category	1
Notes	No obvious significant defects were noted to the internal decoration.

Cellars	
Repair category	-
Notes	Not applicable.

Electricity	
Repair category	2
Notes	It is likely that only the most recently re-wired properties will have electrical installations which fully comply with current regulations. The installation in this property appears relatively modern but there is no evidence of a recent test. It is recommended good practice that all electrical installations should be checked periodically, approximately every ten years or when a property changes hands. This should be regarded as a routine safety and maintenance check.

Gas	
Repair category	1
Notes	No obvious significant defects noted. All gas appliances should be tested and thereafter regularly maintained by a Gas Safe registered contractor.

Water, plumbing and bathroom fittings	
Repair category	1
Notes	The sanitary fittings appeared generally satisfactory commensurate with type and age.
	It is important to maintain a watertight finish around the various fittings and appliances to prevent water spillage causing damage to surrounding surfaces and concealed areas. It is not possible to comment on the condition of concealed areas.

Repair category 1	

Drainage	
Repair category	1
Notes	No obvious significant defects were noted to the drainage system, within the limitations of the inspection.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	2
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	2
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The tenure is understood to be Outright Ownership.

The outright ownership details have not been checked by the surveyor, It is assumed that there are no unusually onerous provisions in the title documents.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchases contracts, further specialists advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

The property has been altered and extended to both front and rear in excess of 20 years ago. Confirmation should be obtained that the work was carried out with local authority approval.

The legal adviser should check confirm that the roads and sewers are adopted by the local authority.

It is assumed that there are no statutory, town planning, road or environmental matters which may have an adverse effect on the marketability or value of the property.

	Estimated reinstatement cost for insurance purposes	
£340,000 (Three hundred and forty thousand pounds).		

Valuation and market comments

In its present condition our opinion of valuation for the Outright Ownership interest assuming full vacant possession on 19 September 2023 can be fairly stated in the sum of:

£285,000 (Two hundred and eighty five thousand pounds sterling).

Signed	Security Print Code [624381 = 6850]O Electronically signed	
Report author Keith Alexander		

Company name	Harvey Donaldson And Gibson
--------------	-----------------------------

Address	Rubislaw Den House, 23 Rubislaw Den North, Aberdeen, AB15 4AL
Date of report	29th September 2023



Property Address			
Address Seller's Name Date of Inspection	7 Parkhill Crescent, Aberdeen, AB2 Mr M Grant, Miss S Harper 19th September 2023	?1 7FY	
Property Details			
Property Type	X House Bungalow Purpose built flat Converted flat	Purpose built maisonette Tenement flat	Converted maisonette Flat over non-residential use Other (specify in General Remarks)
Property Style	X Detached Semi detached Back to back High rise block	Mid terrace Low rise block	☐ End terrace ☐ Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m	ieve that the property was built for th litary, police?	ne public sector,	Yes X No
Flats/Maisonettes only		No. of floors in block No. of units in block	Lift provided? Yes No
Approximate Year of 0	Construction 1970	110.01 01.11.01.01.01.01	
Tenure			
X Absolute Ownership	Leasehold Ground rent £	Unexpired years	
Accommodation			
Number of Rooms	2 Living room(s) 3 Bedroom(s) [1 Bathroom(s) 1 WC(s) [Kitchen(s) Other (Specify in General	remarks)
Gross Floor Area (exc	luding garages and outbuildings) [113 m² (Internal) 130	m² (External)
Residential Element (greater than 40%) X Yes No		
Garage / Parking / 0	Outbuildings		
X Single garage Available on site?	Double garage X Yes No	g space No	garage / garage space / parking space
Permanent outbuilding	js:		
Timber store.			

Construction							
Walls	X Brick	Stone	Concrete	Timber frame	Other	(specify in Gen	eral Remarks)
Roof	X Tile	Slate	Asphalt	Felt	_	(specify in Gen	
Special Risks							
Has the property su	ıffered structı	ıral movement	?			Yes	X No
If Yes, is this recent	t or progressi	ve?				Yes	No
Is there evidence, h immediate vicinity?	istory, or rea	son to anticipa	te subsidence,	heave, landslip or	r flood in the	Yes	X No
If Yes to any of the	above, provi	de details in Ge	eneral Remark	S.			
Service Connect	ion						
Based on visual ins of the supply in Ger			appear to be	non-mains, please	comment or	n the type ar	nd location
Drainage	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	X Mains	Private	None
Central Heating	X Yes	Partial	None				
Brief description of	Central Heat	ing:					
Heating fuel: Gas							
Heating type: Rac	liators						
0.4							
Site							
Apparent legal issu	es to be verif —	ied by the conv	/eyancer. Plea	se provide a brief	description ir	n General Re	emarks.
Rights of way	Shared drive		, ,	amenities on separate		ed service conn	
Ill-defined boundarie	S	Agricultura	Il land included wit	h property	Other	(specify in Ge	neral Remarks)
Location							
X Residential suburb	Resi	dential within town	/ city Mixe	d residential / commerc	cial Mainly	y commercial	
Commuter village	Rem	ote village	Isola	ted rural property	Other	(specify in Ge	neral Remarks)
Planning Issues							
Has the property be	en extended	/ converted / a	altered? X	es No			
If Yes provide detail	ls in General	Remarks.					
Roads							
X Made up road	Unmade road	Partly co	mpleted new road	Pedestrian ad	cess only	Adopted	Unadopted

General Remarks
Other accommodation-utility room.
The subjects form part of an established residential area in the Dyce suburb of Aberdeen , lying some 6 miles north west of the city centre. Surrounding properties are of similar age and character. A wide range of facilities and amenities can be found within a reasonable distance.
The subjects were found to be in a condition of repair consistent with the age and type. Areas of routine maintenance and repair are required.
The property has been altered and extended to both front and rear in excess of 20 years ago. Confirmation should be obtained that the work was carried out with local authority approval.
The legal adviser should check confirm that the roads and sewers are adopted by the local authority.
It is assumed that there are no statutory, town planning, road or environmental matters which may have an adverse effect on the marketability or value of the property.
Facestial Paraire
Essential Repairs
None noted.

Comment on Mortgagea	bility	
The property affords adequence lender's criteria.	quate security for loan purposes based on the valuation figure, subject to i	ndividual
Valuations		
Market value in present condition Market value on completion of essential repairs Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) Is a reinspection necessary?		£ 285,000 £ 340,000
Buy To Let Cases		
month Short Assured Tenan Is the property in an area w	ge of monthly rental income for the property assuming a letting on a 6 ncy basis? There there is a steady demand for rented accommodation of this type?	£
Declaration Signed	Security Print Code [624381 = 6850]O	
Surveyor's name Professional qualifications	Electronically signed by:- Keith Alexander AssocRICS	
Company name Address Telephone	Harvey Donaldson And Gibson Rubislaw Den House, 23 Rubislaw Den North, Aberdeen, AB15 4AL 01224418749	
Fax Report date	0203 880 9193 29th September 2023	

Energy Performance Certificate (EPC)

Dwellings

Scotland

7 PARKHILL CRESCENT, ABERDEEN, AB21 7FY

Dwelling type: Detached house
Date of assessment: 19 September 2023
Date of certificate: 20 September 2023

Total floor area: 113 m²

Primary Energy Indicator: 289 kWh/m²/year

Reference number: 5717-2021-5000-0201-4296 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


gas

You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£8,742	See your recommendations
Over 3 years you could save*	£2,001	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

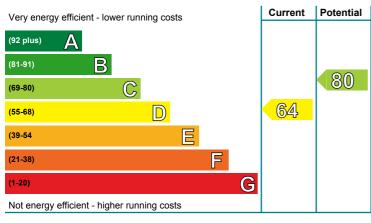


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (64)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

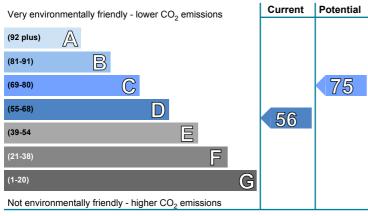

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (56)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£500 - £1,500	£873.00
2 Floor insulation (suspended floor)	£800 - £1,200	£582.00
3 Heating controls (room thermostat)	£350 - £450	£291.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed) Solid brick, as built, insulated (assumed)	***** ****	★★☆☆☆ ★★★★☆
Roof	Pitched, 150 mm loft insulation Pitched, insulated (assumed)	**** ****	★★★★☆ ★★★★☆
Floor	Suspended, no insulation (assumed) Solid, limited insulation (assumed)	_ _	_ _
Windows	Fully double glazed	****	★★★★☆
Main heating	Boiler and radiators, mains gas	****	★★★★☆
Main heating controls	Programmer, TRVs and bypass	***	★★★☆☆
Secondary heating	Room heaters, mains gas	_	_
Hot water	From main system	****	★★★ ☆
Lighting	Low energy lighting in all fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 51 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5.8 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£7,443 over 3 years	£5,694 over 3 years	
Hot water	£813 over 3 years	£561 over 3 years	You could
Lighting	£486 over 3 years	£486 over 3 years	save £2,001
Total	£8,742	£6,741	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.


Recommended measures		Indicative cost	Typical saving	Rating after improvement		
		Indicative cost	per year	Energy	Environment	
1 C	avity wall insulation	£500 - £1,500	£291	D 67	D 61	
2 FI	loor insulation (suspended floor)	£800 - £1,200	£194	C 69	D 64	
3 U _l	pgrade heating controls	£350 - £450	£97	C 70	D 66	
4 Sc	olar water heating	£4,000 - £6,000	£84	C 71	D 67	
5 S	olar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£597	C 80	C 75	

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

External insulation with cavity wall insulation

Choosing the right improvement package





About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

4 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	17,551	(451)	(2,244)	N/A
Water heating (kWh per year)	2,277			_

Addendum

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Keith Alexander

Assessor membership number: EES/021472

Company name/trading name: Harvey Donaldson & Gibson Chartered Surveyors

Address: Rubislaw Den House 23 Rubislaw Den North

23 Rubislaw Den North Aberdeen

AB15 4AL 01224 418749

Phone number: 01224 418749

Email address: frances.wilson@hdg.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Recommendations Report

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Property Address	7 Parkhill Crescent, Dyce, Aberdeen, AB21 7FY
Vendor(s)	Mrs Sarah Grant
Completion Date of Property Questionnaire	21/09/2023 18:41
System Ref:	QV214805-1





Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership					
	How long have you owned the property? 8 years 4 months					
2.	Council Tax					
	Which Council Tax band is your property in?					
	A 😣 B 😣 C 😣 D 😣 E 😣 F 🕖 G 😣 H (×				
3.	Parking					
	What are the arrangements for parking at your property? Please tick all that apply?					
	Garage ✓ Allocated parking space ⊗ Driveway					
	Shared parking ⊗ On street ✓ Resident permit ●	×				
	Metered parking 😢 Other (please specify):					
4.	Conservation area					
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?					
	Don't know	×				
5.	Listed buildings					
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)? No					
6.	Alterations/additions/extensions					
	During your time in the property, have you carried out any structural alterations, additions or Yes	×				
a.	extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?					
(i)	If you have answered yes, please describe below the changes which you have made:					
/m	Did you obtain planning permission, building warrant, completion certificate and other	×				
(ii)	consents for this work?	×				
(iv)	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to you solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	our				



6.	Alterations/additions/extensions			
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below	Yes ♥ No ⊗		
(i)	Were the replacements the same shape and type as the ones you replaced?	Yes ♥ No ⊗		
(ii)	Did the work involve any changes to the window or door openings?	Yes &		
(iii)	Please describe the changes made to the windows doors, or patio doors (with approximate date completed): Replace patio door in small living room October 2019. Please give any guarantees which you received for this work to your solicitor or estate agent	es when the work was		
7.	Central heating			
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).			
	If you have answered yes or partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air) Gas-fired If you have answered yes, please answer the three questions below			
(i)	When was your central heating system or partial central heating installed? Don't know			
	Do you have a maintenance contract for the central heating system?	Yes 🔇		
(ii)	If you answered yes please give details of the company with whom you have a maintenance contract			
(iii)	When was your maintenance contract last renewed? (Please provide the month and year)			
8.	Energy Performance Certificate			
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes ♥ No ⊗		
9.	Issues that may have affected your property			
a.	Has there been any storm, flood, fire, or other structural damage to your property while you have owned it?			
	If you have answered yes is the damage the subject of any outstanding insurance claim?	Yes 🗞 No 🐼		
b.	Are you aware of the existence of asbestos in your property?	Yes ⊗ No ⊘		
	If you have answered yes please give details:			



10.	Services				
	Please tick which services are connected to your property and give details of the supplemental services.				
a.	Service	Connected	Suppli	er	
	Gas or liquid petroleum gas		Octopu	s	
	Water mains or private water supply		Scottish W	/ater	
	Electricity		Octopu	s	
	Mains drainage		Scottish W	/ater	
	Telephone		BT Openre	each	
	Cable TV or satellite		Sky		
	Broadband		BT Openre	each	
	Is there a septic tank at your property?			Yes 😵	
b.	If you have answered yes please answer the questions below			No 🤡	
	Do you have appropriate consents for the	he discharge of you	ur septic tank?	Yes 😵	
(i)				No 😵	
				Don't know 🚫	
	Do you have a maintenance contract for your septic tank?			Yes 😵	
/::\	N				
(ii)	If you answered yes please give details of the company with whom you have a maintenance contract				
11.	Responsibilities for shared or comm	on areas			
	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as repair of a shared drive, private road, boundary, or garden area?				
				Yes 😵	
a.	igaraon aroa.		,,	Yes No	
a.					
а.	If you answered yes please give details		,,	No 🕢	
a.				No ⊘ Don't know ⊗	
a. 	If you answered yes please give details Are you aware of any responsibility to c		st of repair and	No 🕢	
a. 	If you answered yes please give details		st of repair and	No ⊘ Don't know ⊗	
a. b.	If you answered yes please give details Are you aware of any responsibility to c		st of repair and	No ♥ Don't know Yes Yes	
	If you answered yes please give details Are you aware of any responsibility to c		st of repair and	No ♥ Don't know ♦ Yes ♦ No ♥	
	If you answered yes please give details Are you aware of any responsibility to c maintenance of the roof, common stairs		st of repair and	No ♥ Don't know ♦ Yes ♦ No ♥	
b.	If you answered yes please give details Are you aware of any responsibility to comaintenance of the roof, common stairs If you answered yes please give details No Has there been any major repair or repl	vell, or other comm	st of repair and non areas?	No ♥ Don't know ♦ Yes ♦ No ♥	
	If you answered yes please give details Are you aware of any responsibility to c maintenance of the roof, common stairv If you answered yes please give details No	vell, or other comm	st of repair and non areas?	No ODOn't know S Yes No ODOn't know S	
b.	If you answered yes please give details Are you aware of any responsibility to comaintenance of the roof, common stairs If you answered yes please give details No Has there been any major repair or repl during the time you have owned the build bo you have the right to walk over any or service.	vell, or other commacement of any paralleling?	est of repair and non areas?	No ♥ Don't know ♦ Yes ♦ No ♥ Don't know ♦ Yes ♦	
b. c.	If you answered yes please give details Are you aware of any responsibility to comaintenance of the roof, common stairs If you answered yes please give details No Has there been any major repair or repl during the time you have owned the buil	vell, or other commacement of any paralleling?	est of repair and non areas?	No ODOn't know S Yes No ODOn't know S Yes No ODOn't know S	
b.	If you answered yes please give details Are you aware of any responsibility to comaintenance of the roof, common stairs If you answered yes please give details No Has there been any major repair or repl during the time you have owned the build bo you have the right to walk over any or service.	vell, or other commacement of any paralleling?	est of repair and non areas?	No ODON't know S Yes No ODON't know S Yes No Ves No Ves S	



11.	Responsibilities for shared or common areas					
	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin, or to maintain their boundaries?	Yes 😵				
e.		No 🤣				
	If you answered yes please give details					
	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.)	Yes 😵				
f.		No 🤡				
I.	<u>If you answered yes</u> please give details					
12.	Charges associated with your property					
12.	Is there a factor or property manager for your property?	Vac 🛇				
	is there a factor of property manager for your property:	Yes 🔕 No 🕢				
a.	If you answered yes please provide name and address and give details relating to deposits held					
	<u>Ir you answered yes</u> please provide name and address and give details relating to deposits neighbors.	rand charges				
	Is there a common buildings insurance policy?	Yes 😵				
	is there a common buildings insurance policy:	No 🐼				
b.		Don't know 🚫				
D.	If you answered yes is the cost of insurance included in your monthly/annual factor's charges?	Yes				
		No				
Please give details of any other charges you have to pay on a regular basis for the upkeep of co						
C.	areas or repair works, for example to a residents' association, or maintenance or stair N/A	fund.				
13.	Specialist works					
	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes 😵				
	other specialist work ever been carried out to your property:	No 🐼				
	If you answered yes please give further details					
a.						
	Do you have any guarantees for this work?	Yes 😵				
		No 🚫				
	Guarantees are held by :					
	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	Yes 😵				
		No 🕢				
	<u>If you answered yes</u> please give further details					
b.						
	Do you have any guarantees for this work?	Yes 🔕				
		No 😣				
	Guarantees are held by :					



14.	Guarantees					
	Are there any warranties or guarantees for any of the following					
a.		No	Yes	Don't know	With title deeds	Lost
(i) b.	Electrical work	8	8	Ø	8	8
(ii) b.	Roofing	8	8	Ø	8	8
(iii) b.	Central heating	8	8	Ø	8	8
(iv) b.	National House Building Council (NHBC)	Ø	8	8	8	8
(v) b.	Damp course	8	8	Ø	8	8
(vi)	Any other work or installation? (for example cavity wall insulation, underpinning, indemnity policy)		×	×	×	×
b.						
	Are there any outstanding claims under any of the guarantees listed above?			Yes 😵 No 😵		
c.	If you answered yes please give details					
15.	Boundaries					
	Are you aware has any boundary of your property been moved ten years?	in the I	ast			es 😵
a.				Don't know ⊗		
	<u>If you answered yes</u> please give details					



16.	Notices that affect your property		
	In the past three years have you ever receievd a notice :		
a.	Advising that the owner of a neighbouring property has made a planning application?	Yes ⊗ No ⊘	
b.	that affects your property in some other way?	Yes ⊗ No ⊘	
c.	that requires you to perform any maintenance, repairs, or improvements to the property?	Yes ⊗ No ⊘	
	If you answered yes to any of a-c above please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property		

Declaration by the seller(s) or other authorised body or person(s)

I/We confirm that the information on this form is true and correct to the best of my/our knowledge and belief.

Signatures:

Sarah Grant

Moray Grant

Date:



