| Energy performance certificate (EPC) |               |                        |                              |
|--------------------------------------|---------------|------------------------|------------------------------|
| 12, Cherry Tree Dell                 | Energy rating | Valid until:           | 22 June 2025                 |
| SHEFFIELD<br>S11 9DN                 | С             | Certificate<br>number: | 0938-2877-7366-9025-<br>2575 |
| Property type                        |               | Ground-floor flat      |                              |
| Total floor area                     |               | 70 square metres       |                              |

## Rules on letting this property


Properties can be let if they have an energy rating from A to E.

You can read <u>guidance for landlords on the regulations and exemptions</u> (https://www.gov.uk/guidance/domestic-private-rented-property-minimum-energy-efficiency-standard-landlord-<u>guidance</u>).

## **Energy rating and score**

This property's energy rating is C. It has the potential to be C.

See how to improve this property's energy efficiency.

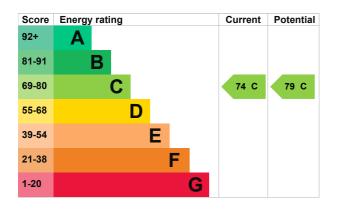

The graph shows this property's current and potential energy rating.

Properties get a rating from A (best) to G (worst) and a score. The better the rating and score, the lower your energy bills are likely to be.

For properties in England and Wales:

the average energy rating is D the average energy score is 60

# Breakdown of property's energy performance

## Features in this property

Features get a rating from very good to very poor, based on how energy efficient they are. Ratings are not based on how well features work or their condition.

Assumed ratings are based on the property's age and type. They are used for features the assessor could not inspect.

| Feature              | Description                                 | Rating    |
|----------------------|---|-----------|
| Wall                 | Cavity wall, filled cavity                  | Good      |
| Window               | Fully double glazed                         | Average   |
| Main heating         | Boiler and radiators, mains gas             | Good      |
| Main heating control | Programmer, room thermostat and TRVs        | Good      |
| Hot water            | From main system                            | Good      |
| Lighting             | Low energy lighting in 75% of fixed outlets | Very good |
| Roof                 | (another dwelling above)                    | N/A       |
| Floor                | Solid, no insulation (assumed)              | N/A       |
| Secondary heating    | None  | N/A       |

### Primary energy use

The primary energy use for this property per year is 182 kilowatt hours per square metre (kWh/m2).

## How this affects your energy bills

An average household would need to spend **£568 per year on heating, hot water and lighting** in this property. These costs usually make up the majority of your energy bills.

You could **save £109 per year** if you complete the suggested steps for improving this property's energy rating.

This is **based on average costs in 2015** when this EPC was created. People living at the property may use different amounts of energy for heating, hot water and lighting.

### Heating this property

Estimated energy needed in this property is:

- 5,205 kWh per year for heating
- 2,005 kWh per year for hot water

| Impact on the environ  | ment            | This property produces   | 2.2 tonnes of CO2     |
|--|-----------------|--|-----------------------|
| This property's environmental i<br>C. It has the potential to be C.                          | mpact rating is | This property's potential production   | 1.7 tonnes of CO2     |
| Properties get a rating from A (<br>(worst) on how much carbon di<br>they produce each year. | ,               | You could improve this pr<br>emissions by making the<br>This will help to protect th | suggested changes.    |
| Carbon emissions   |                 | These ratings are based of about average occupancy                                   | / and energy use.     |
| An average household for a produces  | 6 tonnes of CO2 | People living at the property may use diffe amounts of energy.                       | rty may use different |

## Changes you could make

| Step                              | Typical installation cost | Typical yearly saving |
|-----------------------------------|---------------------------|-----------------------|
| 1. Floor insulation (solid floor) | £4,000 - £6,000           | £58                   |
| 2. Low energy lighting            | £10                       | £11                   |
| 3. Condensing boiler              | £2,200 - £3,000           | £40                   |

#### Help paying for energy improvements

You might be able to get a grant from the <u>Boiler Upgrade Scheme (https://www.gov.uk/apply-boiler-upgrade-scheme)</u>. This will help you buy a more efficient, low carbon heating system for this property.

### More ways to save energy

Find ways to save energy in your home by visiting www.gov.uk/improve-energy-efficiency

# Who to contact about this certificate

#### Contacting the assessor

If you're unhappy about your property's energy assessment or certificate, you can complain to the assessor who created it.

| Assessor's name | Nicholas Thatcher |
|-----------------|-------------------|
| Telephone       | 01142 676 065     |
| Email           | nthatch61@aol.com |

#### Contacting the accreditation scheme

If you're still unhappy after contacting the assessor, you should contact the assessor's accreditation scheme.

| Accreditation scheme | Quidos Limited    |  |
|----------------------|-------------------|--|
| Assessor's ID        | QUID201118        |  |
| Telephone            | 01225 667 570     |  |
| Email                | info@quidos.co.uk |  |

### About this assessment

| Assessor's declaration | No related party |
|------------------------|------------------|
| Date of assessment     | 23 June 2015     |
| Date of certificate    | 23 June 2015     |
| Type of assessment     | RdSAP            |